

SERVICE BULLETIN

CHECKING OR REPLACEMENT

OF FUEL PUMP PART NO. 892230/892235

FOR ROTAX® ENGINE TYPE 912 (SERIES)

SB-912-050

MANDATORY

Repeating symbols:

- Please, pay attention to the following symbols throughout this document emphasizing particular information.
- ▲ WARNING: Identifies an instruction, which if not followed, may cause serious injury or even death.
 - CAUTION: Denotes an instruction which if not followed, may severely damage the engine or could lead to suspension of warranty.
 - ◆ NOTE: Information useful for better handling.

1) Planning information

1.1) Engines affected

All versions of the engine type:

- 912 A from S/N 4,410.684 to S/N 4,410.689
- 912 F S/N 4,412.913
- 912 S from S/N 4,923.282 to S/N 4,923.301

all parts

- Fuel pump, part no. 892230 and 892235, which was supplied as a spare part.

In addition are also effected, all engines and gearboxes installed with fuel pump part no. 892230 or 892235, has installed at engine repair/general Overhaul.

- ◆ NOTE: All engines and gearboxes were already retrofitted with fuel pump part no. 892232 or 892236 are not affected.

1.2) Concurrent ASB/SB/SI and S-

none

1.3) Reason

In limited cases a production deviation of the fuel pump can result in exceeding of the fuel pressure.

1.4) Subject

Checking or replacement of fuel pump part no. 892230/892235 for ROTAX® engine type 912 (Series).

1.5) Compliance

- At first 25^h inspection.
- At the next inspection, if the TSN by 25^h has already been passed.
- At the latest December 31st 2006.

▲ WARNING: Non-compliance with these instructions could result in engine damages, personal injuries or death.

1.6) Approval

The technical content is approved under the authority of DOA Nr. EASA.21J.048.